

NATIONAL TRANSPORTATION SAFETY BOARD
Office of Railroad, Pipeline and Hazardous Material Investigations
Washington, DC 20594

AMTRAK CONSIST

SITE SKETCH

AMTRAK EQUIPMENT DOCUMENTATION

COUPLERMATE
R22 EO 60 CHI-EMY
END OF TRAIN DEVICE

17MAR 2152 AED ACP060
BNNNN


QU BNRR

.BNRA 172153

DC A	S	17MAR01							
P1	R1		BD P42-8 DEN-EMY/38		5	17MAR01	ICC	BD P42-8	
P2	R2		BD P42-8 CHI-EMY/140	8 END	5	17MAR01	ICC	BD P42-8	
P3	R3		BD P42-8 CHI-EMY/141		5	17MAR01	ICC	BD P42-8	
P4	R4		DD 00 CHI-EMY/PC4008		5	17MAR01	ICD	BD P42-8	
DEADHEAD									
P5	R5		BA 70 CHI-EMY/1517		5	17MAR01	ICC	ME 60	SIDE
EMY MAIL MHC									
P6	R6		BA 70 CHI-EMY/1195		5	17MAR01	ICC	BA 70	SIDE
BAGGAGE CAR									
P7	R7		ST 35 CHI-EMY/39040		5	17MAR01	ICC	ST 35	SIDE
NON-REVENUE CREW ONLY									
P8	R8	0512	SC 74 CHI-EMY/34071	FLAT CAR	5	17MAR01	ICC	SC 74	CROSSWAYS UPRIGHT
COACH									
P9	R9	0511	SC 74 CHI-EMY/34070	FLAT CAR	5	17MAR01	ICC	SC 74	SIDE
COACH									
P10	R10	0510	SM 62 CHI-EMY/31522	FLAT CAR	5	17MAR01	ICC	SM 62	CROSSWAYS UP RIGHT
SMOKING COACH									
P11	R11		SR 70 CHI-EMY/33034		5	17MAR01	ICC	SR 70	60°
LOUNGE									
P12	R12		SF 72 CHI-EMY/38033		5	17MAR01	ICC	SF DEN 64	30°
DINER									
P13	R13	0531	SS 44 CHI-EMY/32096	A END	5	17MAR01	ICC	SS 06-15	UPRIGHT
SLEEPER									
P14	R14	0532	SS 44 CHI-EMY/32049		5	17MAR01	ICC	SS 06-15	UPRIGHT
SLEEPER									
P15	R15		ME 60 CHI-EMY/70041		5	17MAR01	ICL	ME 60	
EXPRESS TO EMY									
P16	R16		ME 60 CHI-EMY/71149		5	17MAR01	ICL	ME 60	
EXPRESS TO EMY									
P17	R17		ME 60 CHI-EMY/70005		5	17MAR01	ICL	ME 60	
EXPRESS TO EMY									
P18	R18		BA 80 CHI-DEN/71198		6	17MAR01	ICL	ME 60	
MAIL - TO TRAIN 6 SAME DAY									
P19	R19		RC 00 CHI-DEN/5223		5	17MAR01	ICC	RC 00	
COUPLERMATE									
P20	R20		RV 53 CHI-DEN/TC466855	RR	5	17MAR01	ICC	RV 53	
EXPRESS - TRIPLE CROWN									
P21	R21		RC 00 CHI-DEN/5204		5	17MAR01	ICC	RC 00	
COUPLERMATE									
R22 EO 60 CHI-EMY									
END OF TRAIN DEVICE									

DC A	5	17MAR01				
P1 R1		BD P42-8	DEN-EMY/38	5	17MAR01	ICC BD P42-8
P2 R2		BD P42-8	CHI-EMY/140	5	17MAR01	ICC BD P42-8
P3 R3		BD P42-8	CHI-EMY/141	5	17MAR01	ICC BD P42-8
P4 R4		DD 00	CHI-EMY/PC4008	5	17MAR01	ICD PE CBCAR
DEADHEAD						
P5 R5		BA 70	CHI-EMY/1517	5	17MAR01	ICC MH 61
EMY MAIL						
P6 R6		BA 70	CHI-EMY/1195	5	17MAR01	ICC BA 80
BAGGAGE CAR						
P7 R7		ST 35	CHI-EMY/39040	5	17MAR01	ICC ST 35
NON-REVENUE CREW ONLY						
P8 R8	0512	SC 74	CHI-EMY/34071	5	17MAR01	ICC SC 74
COACH						
P9 R9	0511	SC 74	CHI-EMY/34070	5	17MAR01	ICC SC 74
COACH						
P10 R10	0510	SM 62	CHI-EMY/31522	5	17MAR01	ICC SM 62
SMOKING COACH						
P11 R11		SR 70	CHI-EMY/33034	5	17MAR01	ICC SR 70
LOUNGE						
P12 R12		SF 72	CHI-EMY/38033	5	17MAR01	ICC SF DIN64



DINER
P13 R13 0531 SS 44 CHI-EMY/32096 5 17MAR01 ICC SS 06-15
SLEEPER
P14 R14 0532 SS 44 CHI-EMY/32049 5 17MAR01 ICC SS 06-15
SLEEPER
P15 R15 ME 60 CHI-EMY/70041 5 17MAR01 ICL MV 50
EXPRESS TO EMY
P16 R16 ME 60 CHI-EMY/71149 5 17MAR01 ICL ME 60
EXPRESS TO EMY
P17 R17 ME 60 CHI-EMY/70005 5 17MAR01 ICL MV 50
EXPRESS TO EMY
P18 R18 BA 80 CHI-DEN/71198 6 17MAR01 ICL ME 60
MAIL - TO TRAIN 6 SAME DAY
P19 R19 RC 00 CHI-DEN/5223 5 17MAR01 ICC RU 00
COUPLERMATE
P20 R20 RV 53 CHI-DEN/TC466855 5 17MAR01 ICC RV 53
EXPRESS - TRIPLE CROWN
P21 R21 RC 00 CHI-DEN/5204 5 17MAR01 ICC RU 00
COUPLERMATE
R22 EO 60 CHI-EMY
END OF TRAIN DEVICE





SITE SKETCH

AMTRAK CALIF. BERRY 5(17)
MORAWAY, IOWA MP 419.85
18 MARCH, 2001
BY P.D. HALL

ANGLES (FM SOUTH)

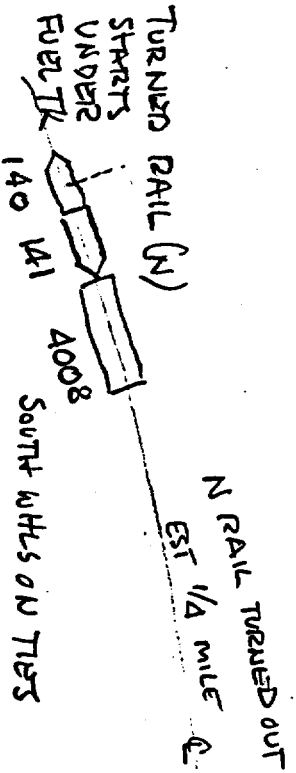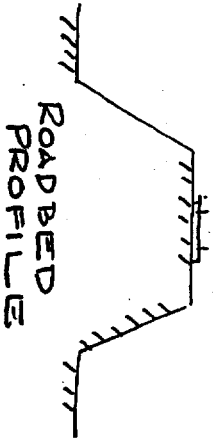

140-R TRUCKS DERAILED ON TURN
141-FTR TRUCKS S "

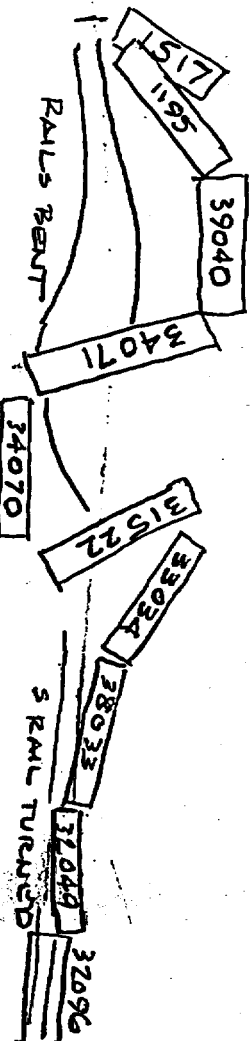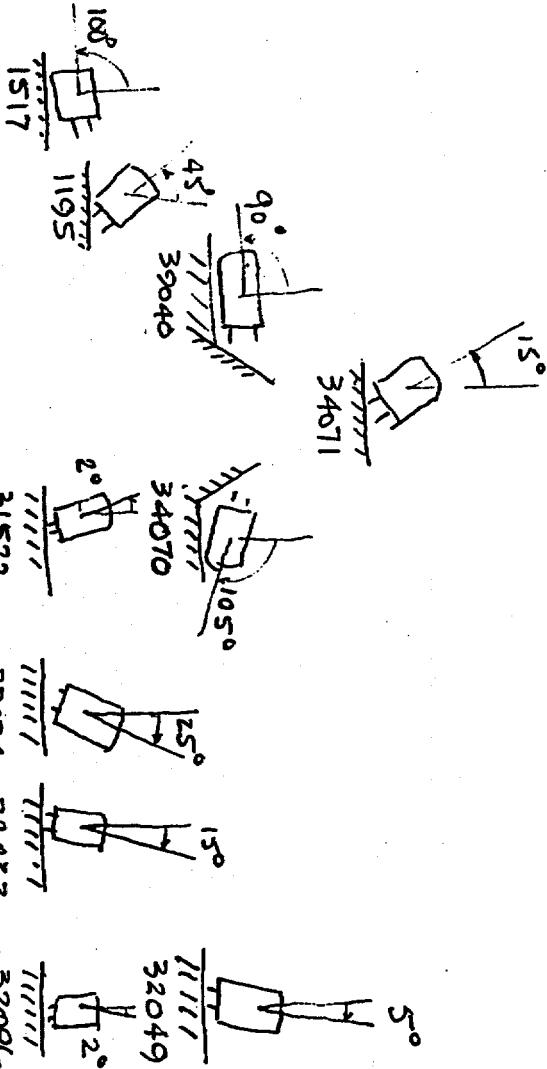

MAIL/EX CARLS NOT DR.

- 70041
- 71149
- 70005
- 71198

4U6855

AMTRAK EQUIPMENT INVENTORY

P-40 or P-42 LOCOMOTIVES

DATE: 3/18 TIME: 10:30A TRAIN NO.: 5(17) LOCATION: NADAWAY INSPECTOR: PDH

Locomotive Number / Location in consist: 140 # 1

Final Orientation / General Exterior Condition: UPRIGHT, NOT DETAILLED

A or B end forward. (Circle one)

Degree of list, if any, and direction of list: 0 Degrees, (Circle direction) N, S, E, W

Emergency Lights: ~~ON or OFF~~ (Time:) N/A

Damaged and or Missing (Explain) NONE

ITEM	REMARKS	ITEM	REMARKS
Fuel Tank	NOT INSPECTED	Emergency Tools	
		Maul	
		Pry Bar	
Was there a Spill? Approx. how much?		First Aid Kit	
		Fire Extinguisher	
		Cab Date:	
		Fire Extinguisher	
		Engine Room Date:	
Windows		Doors	
Windshield		Entry, Engr Side	
Windows, Engr Side		Entry, Fire Side	
Windows, Fire Side		Entry Engr Mid Door	
		Entry Fire Mid Door	
		Entry Engr Rear Door	
		Entry Fire Rear Door	
Seats	Entry, "B" End		
Engineer	Engine Room		
Fireman	Engine		
Batteries & Box	Compressor		
Condition of Batteries			
Battery Retention Device	Location of Seriously Injured Persons (if known)		

AMTRAK EQUIPMENT INVENTORY

P-40 or P-42 LOCOMOTIVES

DATE: 3/18/01 TIME: 10:30 TRAIN NO.: 517 LOCATION: MIDWAY INSPECTOR: PDH

Locomotive Number / Location in consist: 141 # 2

Final Orientation / General Exterior Condition: UPRIGHT / NOT DAMAGED

A or B end forward. (Circle one) B



Degree of list, if any, and direction of list: 0° Degrees, (Circle direction) N, S, E, W

Emergency Lights: ON or OFF (Time: N/A)

Damaged and or Missing (Explain) NONE, EXCEPT WHEELS

ITEM	REMARKS	ITEM	REMARKS	
Fuel Tank	NOT INSPECTED	Emergency Tools		
		Maul		
		Pry Bar		
Was there a Spill? Approx. how much?		First Aid Kit		
		Fire Extinguisher		
		Cab Date:		
		Fire Extinguisher		
		Engine Room Date:		
Windows			Doors	
Windshield			Entry, Engr Side	
Windows, Engr Side		Entry, Fire Side		
Windows, Fire Side		Entry Engr Mid Door		
		Entry Fire Mid Door		
		Entry Engr Rear Door		
		Entry Fire Rear Door		
Seats				
Engineer		Entry, "B" End		
Fireman		Engine Room		
		Engine		
Batteries & Box		Compressor		
Condition of Batteries				
Battery Retention Device		Location of Seriously Injured Persons (if known)		

P-40 or P-42 LOCOMOTIVE 140/141

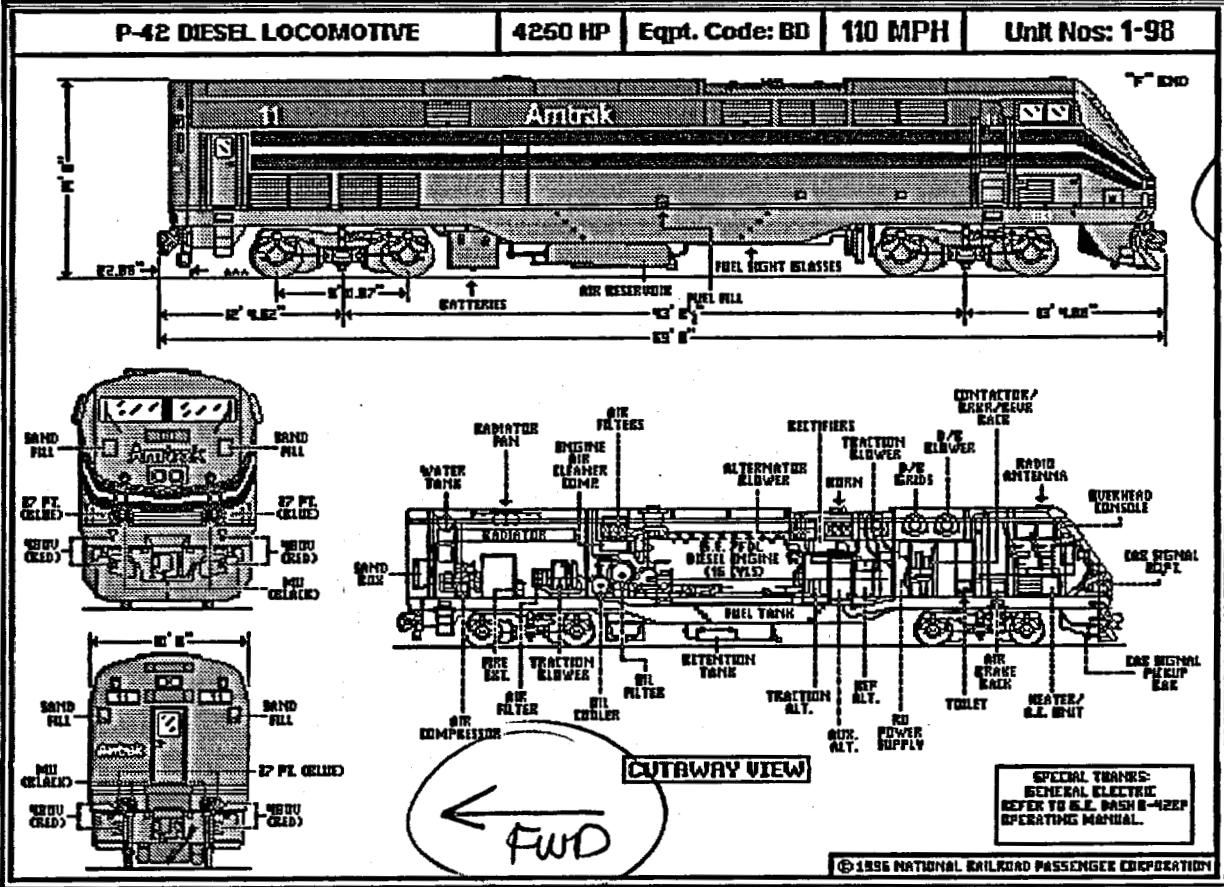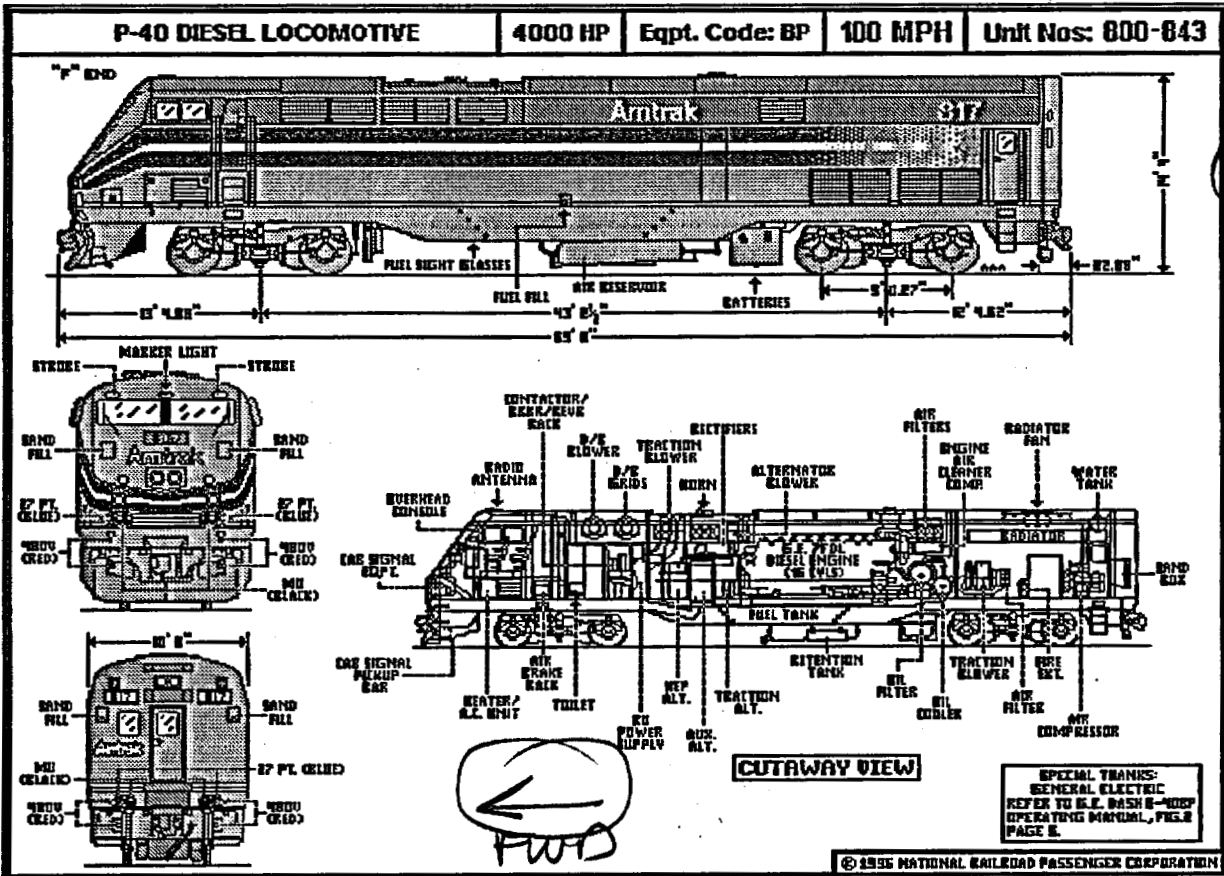

500 1517
MATERIAL HANDLING CAR 1400




MATERIAL HANDLING CAR

Equipment Code: MH

110 MPH

Car Numbers: 1400-1473

DOOR HEIGHT:
6' 8 1/2"

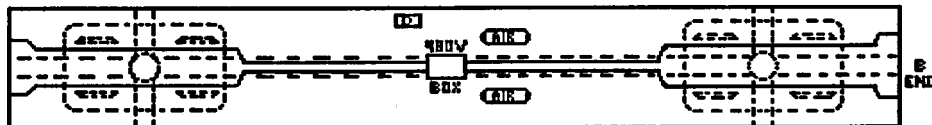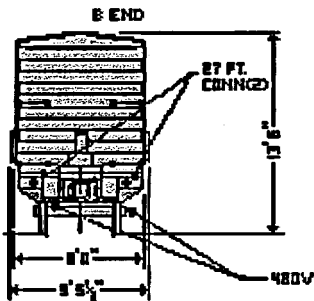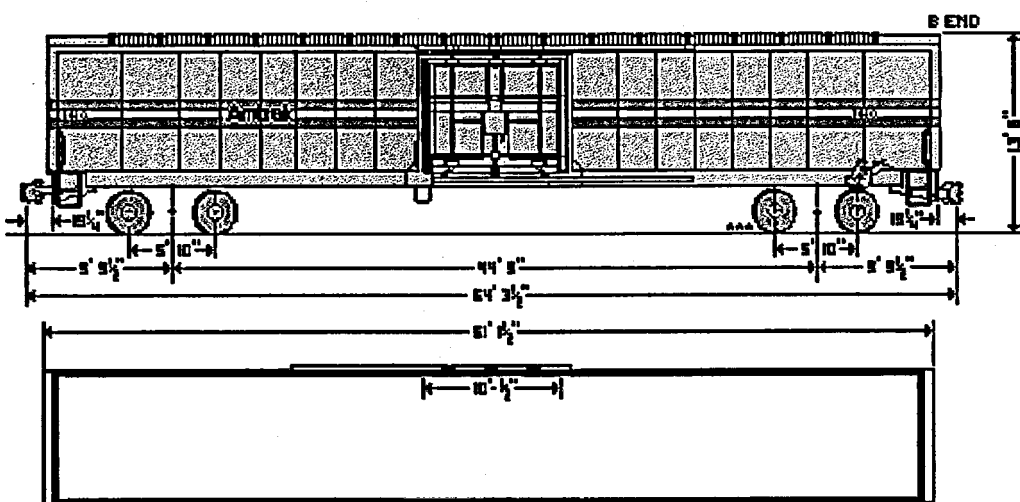

UNDERBODY VIEW THROUGH FLOOR

© 1956 NATIONAL RAILROAD PASSENGER CORPORATION

USE THIS SPACE FOR ADDITIONAL REMARKS OR TO ATTACH PHOTOGRAPHS.

SIDE/END DAMAGE
BAGGAGE CAR RESTING ON TOP
OF L SIDE

AMTRAK EQUIPMENT INVENTORY

BAGGAGE CAR

DATE: 3/18/01 TIME: 10:30A TRAIN NO.: 57 LOCATION: NODAWAY INSPECTOR: PDH

Car Number / Location in consist: 1195 # 5

Final Orientation / General Exterior Condition: ON SIDE / ON TOP OF 1517 / IN DITCH

A or B end forward. (Circle one)

Degree of list, if any, and direction of list: 45° Degrees, (Circle direction) N, S, E, W

Emergency Lights: ON or OFF (Time: N/A)


Damaged and or Missing (Explain)

Emergency Evacuation Cards Total: NOT APPLICABLE

ITEM	REMARKS	ITEM	REMARKS	
Luggage Racks/ Dividers	NOT INSPECTED	Emergency Tools		
		Maul		
		Pry Bar		
		First Aid Kit		
		Light Sticks		
		Fire Extinguisher		
		Date:		
		Doors		
		Eng.'s Side Door #1		
		Eng.'s Side Vestibule #2		
		Fire.s Side Door #1		
Emergency Signage			Fire.'s Side Vestibule #2	
Interior			Entry, "A" End	
Exterior			Entry, "B" End	
End Crash Bars			Location of Seriously Injured Persons (If known)	
A End				
B End		Other (Specify)		
Batteries & Box				
Condition of Batteries				
Battery Retention Device				
Emerg. Evac. Cards	NOT APPLICABLE			

BAGGAGE CAR

1195

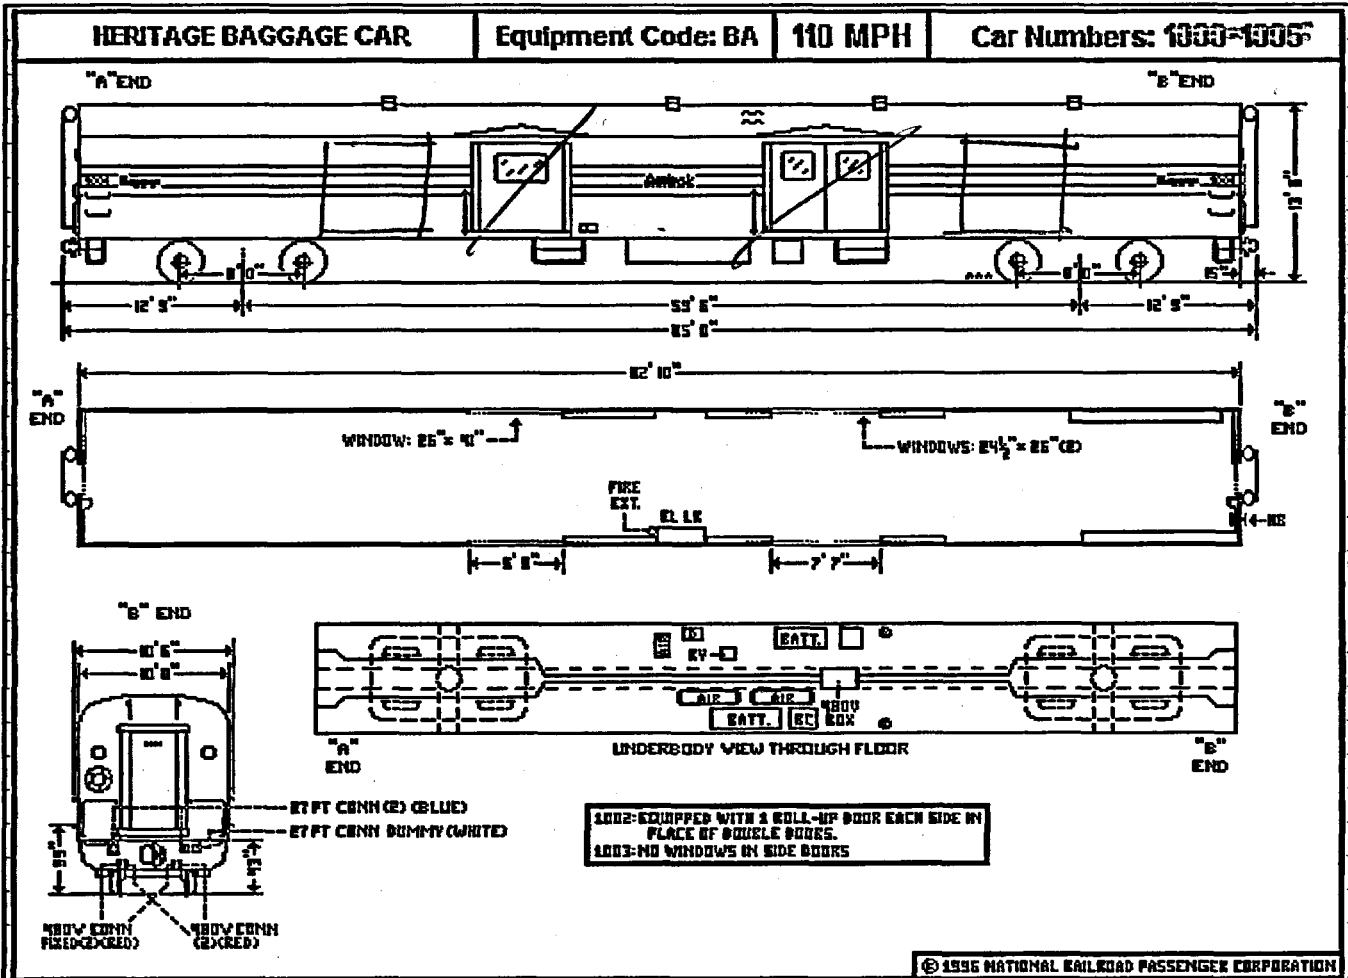

RESTING ON TOP OF 1517

and 3/20/01 1030-1130

AMTRAK EQUIPMENT INVENTORY

SUPERLINER II TRANSITION SLEEPER/DORMITORY CAR

DATE: 3/19/01 TIME: 3:30 TRAIN NO.: 5 LOCATION: NODAWAY, IA INSPECTOR: PDH/JH

Car Number / Location in consist: 39040 # 6

Final Orientation / General Exterior Condition: ON SIDE IN DITCH

A or B end forward. (Circle one)

Degree of list, if any, and direction of list: 90° Degrees, (Circle direction) (N, S, E, W)

Emergency Lights: ON or OFF (Time: 3:30p)

Emergency Windows Open (List by seat location and whether opened from inside (I) or outside (O))

See Diagram

Seats Unlocked and or Turned (List by seat number)

None

Damaged and or Missing (Explain)

See Below

Emergency Evacuation Cards Total Upper and Lower:

NOT APPLICABLE

LOWER LEVEL

ITEM	REMARKS	ITEM	REMARKS
Lavatories	18" Low wall out, Ext intrusion Other lavs not accessible	Emergency Tools	
		Maul	✓
		Pry Bar	✓
		First Aid Kit	✓
		Light Sticks	✓
Tables	OK in place	Fire Extinguisher	✓
		Date:	3/01/01 OAK
Luggage Racks/ Dividers	OK in place	Doors	
		Entry, Eng.'s Side	In ditch - buckled in
		Entry, Fire.'s Side	Buckled in
Emergency Signage		Entry Door to Lounge	Open, jammed
Interior	OK		
Exterior	OK		
End Crash Bars		Location of Seriously Injured Persons (If known)	N/A
A End	OK		
B End	OK		
Batteries & Box		Step Box	
Condition of Batteries	NOT accessible	Step Box	In place in Vest.
Battery Retention Device		ADA ramp	In place
		ADA retention strap	In place


39040

SUPERLINER II TRANSITION DORM

SUPERLINER II TRANSITION DORM | Equipment Code: ST | 100 MPH | Car Nos: 39000-39011

NOT BEDROOM
LABORATORY
SIGNIFICANT
INTRUSION
OF FENCE
POST

NAIL
BTW
2nd
floor
B. bed

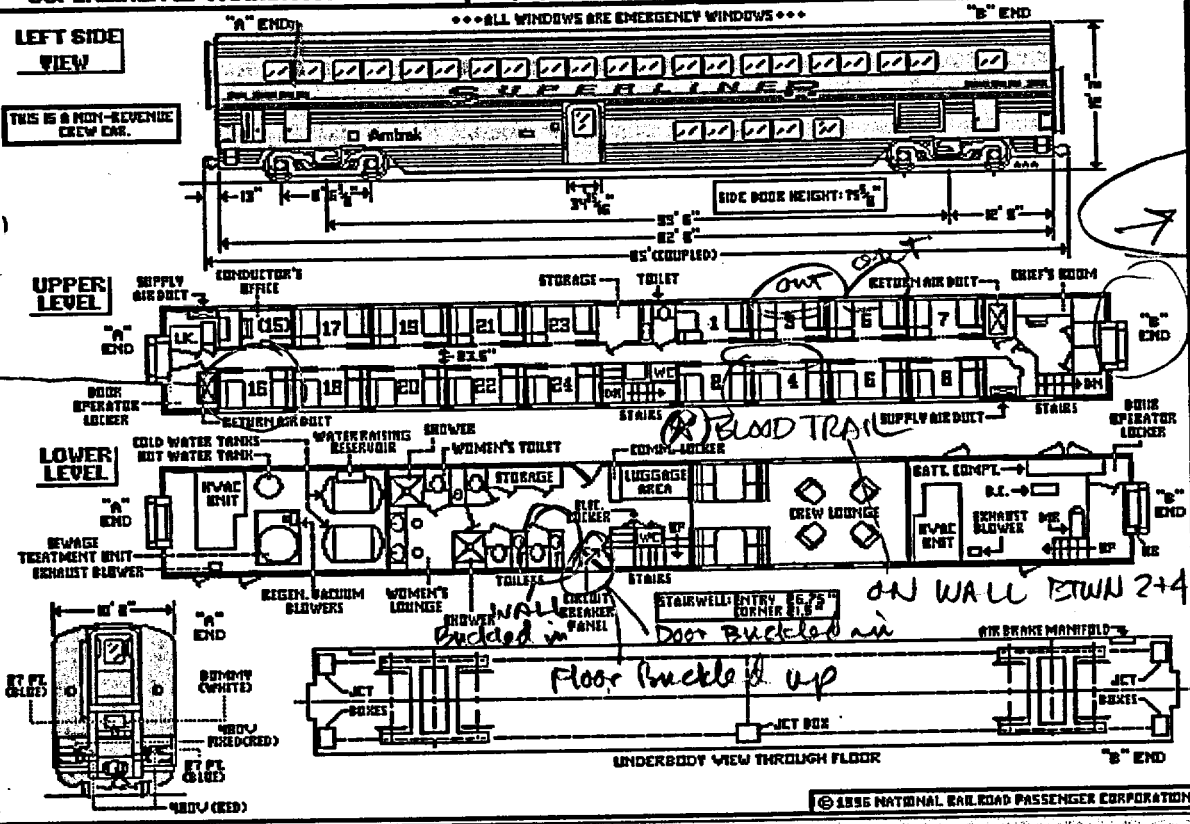

UPPER LEVEL


ITEM	REMARKS	ITEM	REMARKS
Lavatories/Mirrors	INTRUSION IN #16 LAV - FENCE POST THROUGH WALL	Emergency Tools	
Doors/Beds/Walls		Maul	OK
Room # 1	BUNK UP	Pry Bar	MISSING
Room # 2	Bunk down	First Aid Kit	MISSING
Room # 3	BUNK UP WINDOW OUT	Light Sticks	OK
Room # 4	Blood on door / door jammed open	Fire Extinguisher	OK 3/1/01 OK
Room # 5	BUNK UP WINDOW OUT	Date:	
Room # 6		Doors	
Room # 7		End Door "A" End	OK - open
Room # 8	DOOR OFF TRACK	End Door "B" End	OK - closed
Room # 9		Location of Seriously Injured Persons (if known)	NTM
Room # 10	N/A	Other (Specify)	
Room # 11			
Room # 12			
Room # 13			
Room # 14			
Room # 15	OK - pocket wall at bottom 3"		
Room # 16	Shower/toilet		
Room # 17	BUNK UP LOCKED w/ LUGGAGE / DISAP - WALL AS IS	End Crash Bars	
Room # 18	BUNK UP EMPTY OPEN	A End	OK
Room # 19	OK - one cushion in 18	B End	OK
Room # 20	OK - Door window broken	Emergency Signage	
Room # 21	OK - 1 seat cushion in 22	Interior	OK
Room # 22	OK Door JAMMED OPEN	Exterior	OK
Room # 23	BUNK UP OK		
Room # 24	BUNK UP OK		

#21
up

⊗ HIGH SIDE

32071

SUPERLINER I COACH

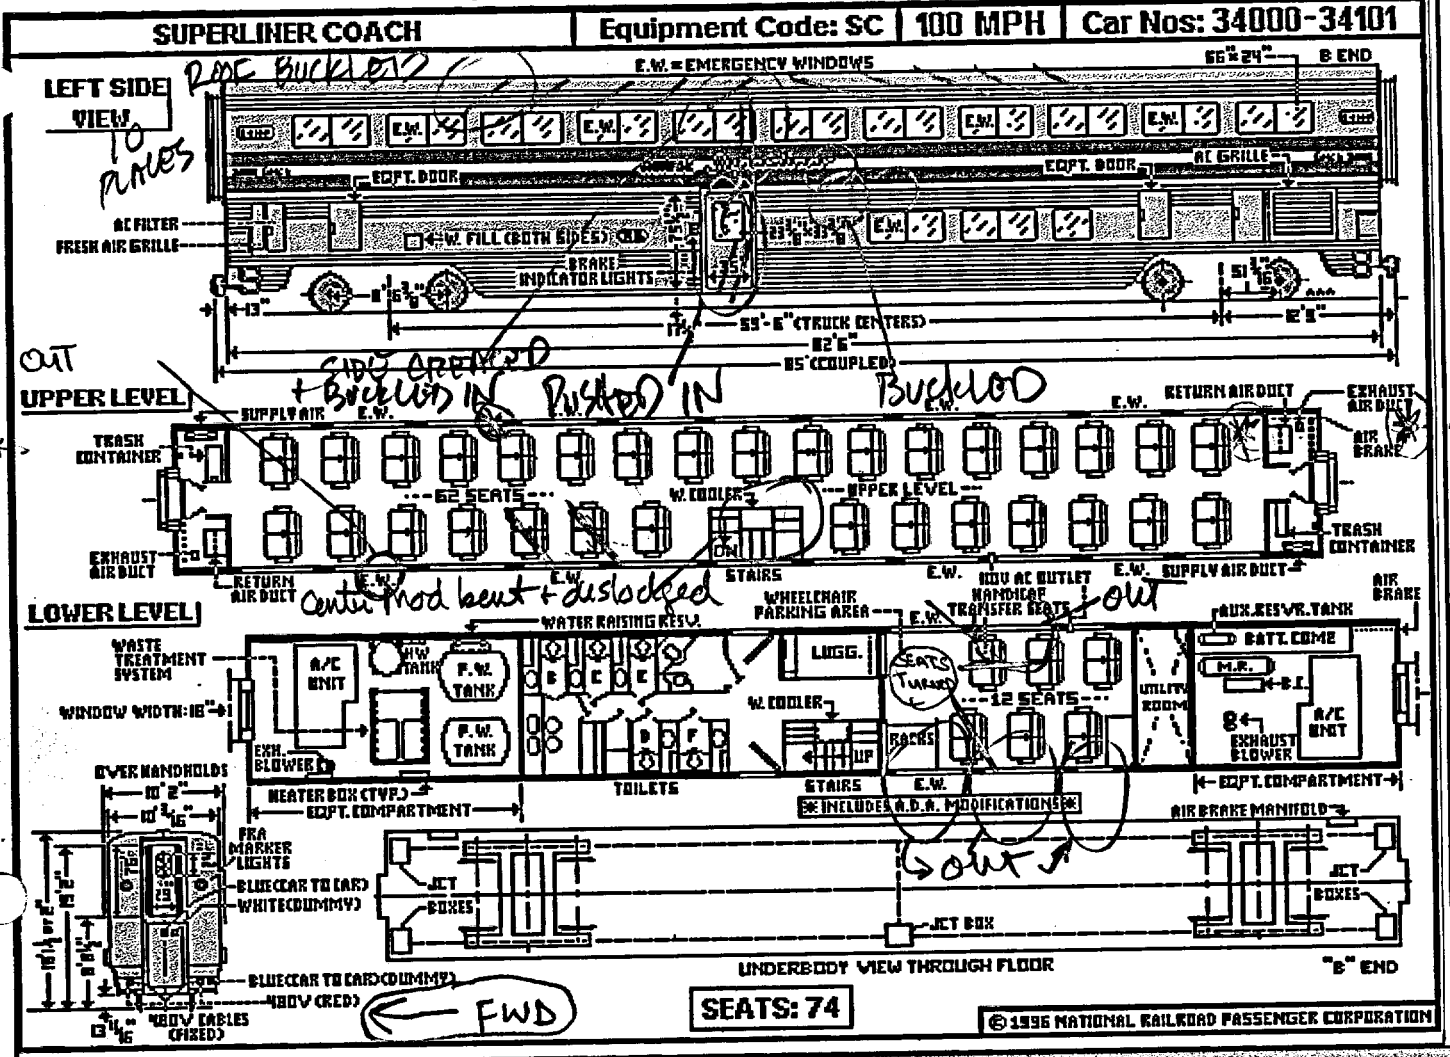

UPPER LEVEL

ITEM	REMARKS	ITEM	REMARKS
Luggage Racks/Dividers	✓ ALL OK	Emergency Tools	
		Maul	✓
		Pry Bar	MISSING
		First Aid Kit	✓
		Light Sticks	gone
		Fire Extinguisher	✓
		Date:	3/01/01 OK
Interior		Doors	
Exterior		End Door "A" End	
		End Door "B" End	✓ OK & OPEN
End Crash Bars			
"A" End	OK		
"B" End			
Other (Specify)		Location of Seriously Injured Persons (if known)	N/A

AND 3/20/01 @ 0800 - 0945

AMTRAK EQUIPMENT INVENTORY - SUPERLINER I COACH

DATE: 3/18/01 TIME: 3:30 TRAIN NO.: 5(17) LOCATION: NODAWAY INSPECTOR: PHT, JH

Car Number / Location in consist: 34071 #7

Final Orientation / General Exterior Condition: ACROSS TRACK

A or B end forward. (Circle one)

Degree of list, if any, and direction of list: 15° Degrees, (Circle direction) N, S, E, W

Emergency Lights: ON or OFF (Time:)

Emergency Windows Open (List by seat location and whether opened from inside (I) or outside (O))

SEE DIAGRAM

INSPECTED
AFTER BEING
ROLLED INTO
DITCH DURING
RECOVERY

Seats Unlocked and or Turned (List by seat number)

23/24, 19/20

Damaged and or Missing (Explain)

Center Module - bent/buckled / upper cabinet panel + water panel

Emergency Evacuation Cards Total Upper and Lower: of 74 *dislodged*

LOWER LEVEL

NO ENTRY
355-
7164
-1010101

ITEM	REMARKS	ITEM	REMARKS
Lavatories	HANDICAP. Lava. Door BENT	Emergency Tools	
LAVATORY F. sign. INTRUSION FROM OUTSIDE	BOTTOM EDGE BUCKLED / FLR.	Maul	MISSING
FIXTURES BROKEN	BUCKLED UP APPROX 4"	Pry Bar	OK ✓ here (LOOSE)
WATER MODULE BENT	HALLWAY WALL MOVED SIDEWAYS APPROX 9"	First Aid Kit	OK ✓
Mirrors	OK	Light Sticks	
FIXTURES	IN PLACE	Fire Extinguisher	OK 3/1/01 OK
HANDICAP MIRROR	DISLODGED IN VESTIBULE BROKEN LOWER LEFT CORNER	Date:	
Luggage Racks/ Dividers		Doors	
		Entry, Eng.'s Side	JAMMED OPEN BY STEP BOX
		Entry, Fire.'s Side	SIGNIFICANT INTRUSION APPROX 1 FT INTO VESTIBULE - FLR BUCKLED 6 IN. UPWARD
Emergency Signage		Location of Seriously Injured Persons (If known)	NOT KNOWN
Interior			
Exterior			
Batteries & Box		Other (Specify)	
Condition of Batteries	NOT AVAILABLE - DOWN SIDE	Step Box	OK here
Battery Retention		ADA ramp	IN PLACE
Device		ADA retention strap	OK IN PLACE
		End Crash Bars	
		"A" End	
		"B" End	

AMTRAK EQUIPMENT INVENTORY - SUPERLINER I COACH

DATE: 3/18/01 TIME: 2:50 TRAIN NO.: 5(M) LOCATION: No DAWAY INSPECTOR: PDH, JG, JEK

Car Number / Location in consist: 34070 # 8

Final Orientation / General Exterior Condition: ON SIDE IN DITCH

A or B end forward. (Circle one)

Degree of list, if any, and direction of list: 112° Degrees, (Circle direction) N(S), E, W

Emergency Lights: ON or OFF (Time: 2:50)

Emergency Windows Open (List by seat location and whether opened from inside (I) or outside (O))
 WINDOWS ON LT SIDE (DOWN) INTACT

INJURY LOCATIONS
 DOCUMENTED BY
 DSI/VOLPE
 3/19/01 1:00 PM

Seats Unlocked and or Turned (List by seat number)
 ALL SEATS STILL ATTACHED
 MANY ON RT SIDE (UP) TURNED

Damaged and or Missing (Explain)
 SEE DIAGRAM

Emergency Evacuation Cards Total Upper and Lower: of 74

LOWER LEVEL

ITEM	REMARKS	ITEM	REMARKS
Lavatories	JAMMED SHUT	Emergency Tools	
		Maul	✓
		Pry Bar	✓
		First Aid Kit	✓
		Light Sticks	✓
Mirrors	/	Fire Extinguisher	✓
	MID-CAR RACK DROPPED TO LOW SIDE	Date:	1/3/01
Luggage Racks/ Dividers	CEILING BUCKLED ABOVE LUGGAGE RACKS - LT SIDE	Doors	
	RACKS BROKEN - LT SIDE	Entry, Eng.'s Side	
Emergency Signage	OK	Entry, Fire.'s Side	DOWN ON SIDE
Interior	OK	Location of Seriously Injured Persons (If known)	/
Exterior	OK		
Batteries & Box		Other (Specify)	
Condition of Batteries		Step Box	OK
Battery Retention		ADA ramp	Dropped to low side
Device		ADA retention strap	Gone
		End Crash Bars	
FRAME	CEILING SHOWS WAVES	"A" End	
		"B" End	


34070

SUPERLINER I COACH


SUPERLINER COACH

Equipment Code: SC 100 MPH Car Nos: 34000-34101


LEFT SIDE VIEW

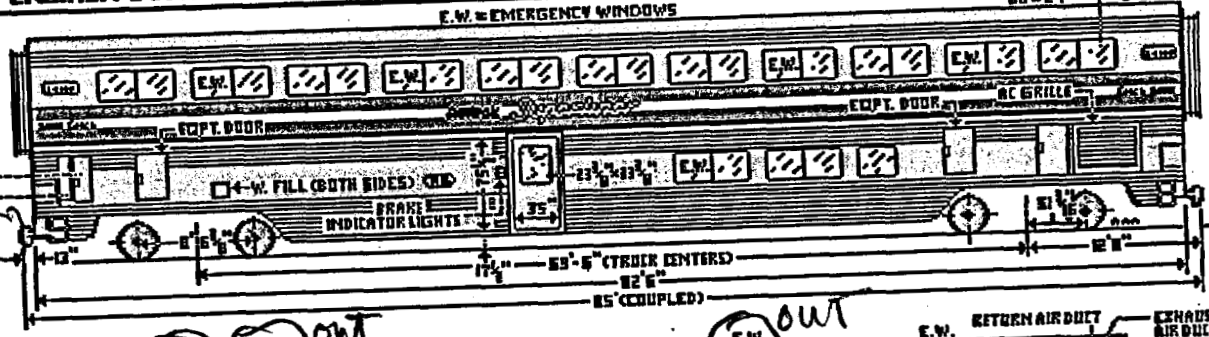

UPPER LEVEL

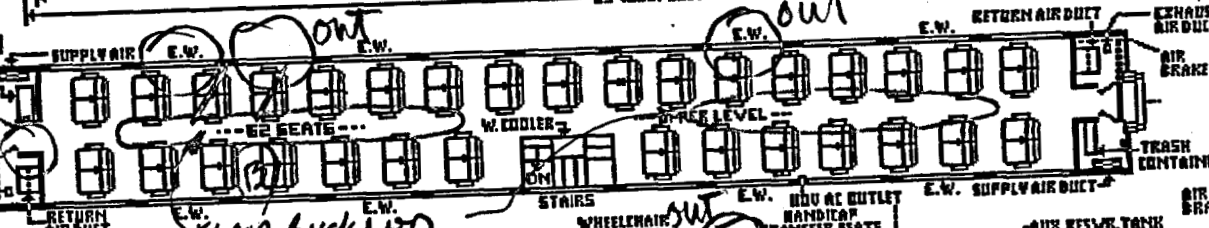

LOWER LEVEL

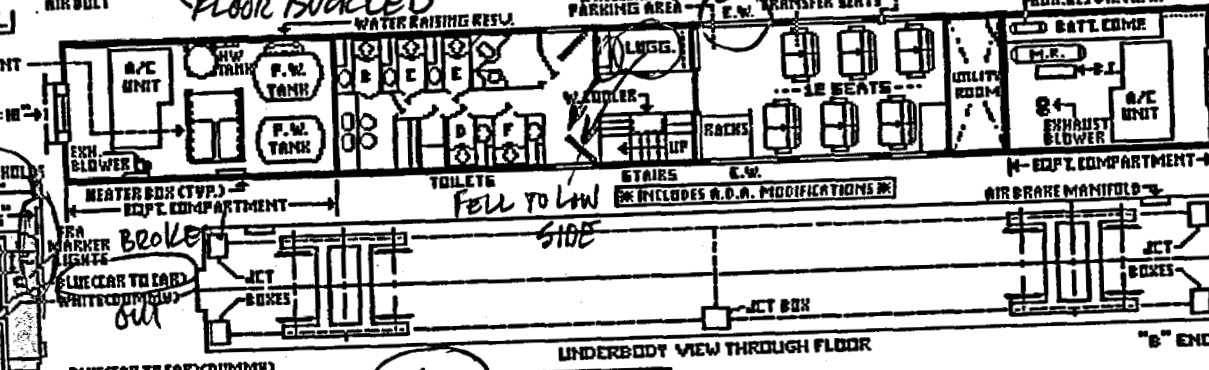

STILL ATTACHED TO 34071 KNUCKLE

WALL PUSHED IN

PUSHED IN

A END

FWD

SEATS: 74

© 1985 NATIONAL RAILROAD PASSENGER CORPORATION

UPPER LEVEL

ITEM	REMARKS	ITEM	REMARKS
Luggage Racks/Dividers	BENT/BROKEN/BUCKLED SEVERAL PLACES	Emergency Tools	
		Maul	MISSING
		Pry Bar	MISSING
		First Aid Kit	✓
		Light Sticks	✓
		Fire Extinguisher	✓
		Date:	1/3/01 OAK
Emergency Signage	OK	Doors	
Interior	OK	End Door "A" End	OPEN
Exterior	OK	End Door "B" End	CLOSED w/ GRAVITY
End Crash Bars			
"A" End	OK		
"B" End	OK		
Other (Specify)		Location of Seriously Injured Persons (if known)	15/16 Lot of blood/Pillows @ 19/20 window 27 - UPPER Lt molding shattered
(B)	Blood Spatters at Window 15/16 on Luggage Rack underside		NO EVIDENCE ON CEILING
		OTHER	DRAWBAR STILL ATTACHED TO KNUCKLE FM 34071
Emerg. Evac. Cards	of 62		

AMTRAK EQUIPMENT INVENTORY

SUPERLINER COACH/SMOKING CAR

DATE: 3/19 TIME: 11:15 TRAIN NO. 6(17) LOCATION: NoDWAY Inspector: PDH

Car Number / Location in consist: 31522 / #9

Final Orientation / General Exterior Condition: At angle to track, upright

A of B end forward. (Circle one) **B**

Degree of list, if any, and direction of list: (Circle direction) N, S, E, W

Emergency Lights: ON or OFF **OFF** Time:

Emergency Windows Open (List by seat location and whether opened from inside (I) or outside (O)) **See diagram** SIDE

Seats Unlocked and or Turned (List by seat number) 1/2, 2/22, 45/46 reversed

Damaged and or Missing (Explain) **See diagram**

Emergency Evacuation Cards Total Upper and Lower: All in place


POST-RECOVERY
INSPECTION
CAR ON LEFT

LOWER LEVEL

ITEM	REMARKS	ITEM	REMARKS
Lavatories		Emergency Tools	
A	ALL DOORS JAMMED DUE CAR ON SIDE	Maul	✓
B		Pry Bar	✓
C		First Aid Kit	✓
D		Light Sticks	✓
E		Fire Extinguisher	✓
F		Date:	
Mirrors		Doors	
A	/	Entry, Eng.'s Side	Damaged - dents
B		Entry, Fire.'s Side	Damaged - buckled
C		Entry Door to Smoking Area	Jammed @ angle - lower edge forward.
D		Restroom Doors	
E		A	
F		B	
Luggage Racks/ Dividers	ok	C	
Emergency Signage		D	
Interior	ok	E	
Exterior	ok	F	
End Crash Bars		Location of Seriously Injured Persons (If known)	None noted
A End	ok		
B End	ok	Other (Specify)	
		Step Box	N/A
		ADA ramp	N/A
		ADA retention strap	N/A
Emerg. Evac. Cards	NOT APPLICABLE		

SUPERLINER COACH/SMOKING CAR

SUPERLINER SMOKING COACH | Equipment Code: SM | 100-MPH | Car Nos: 31500-31547

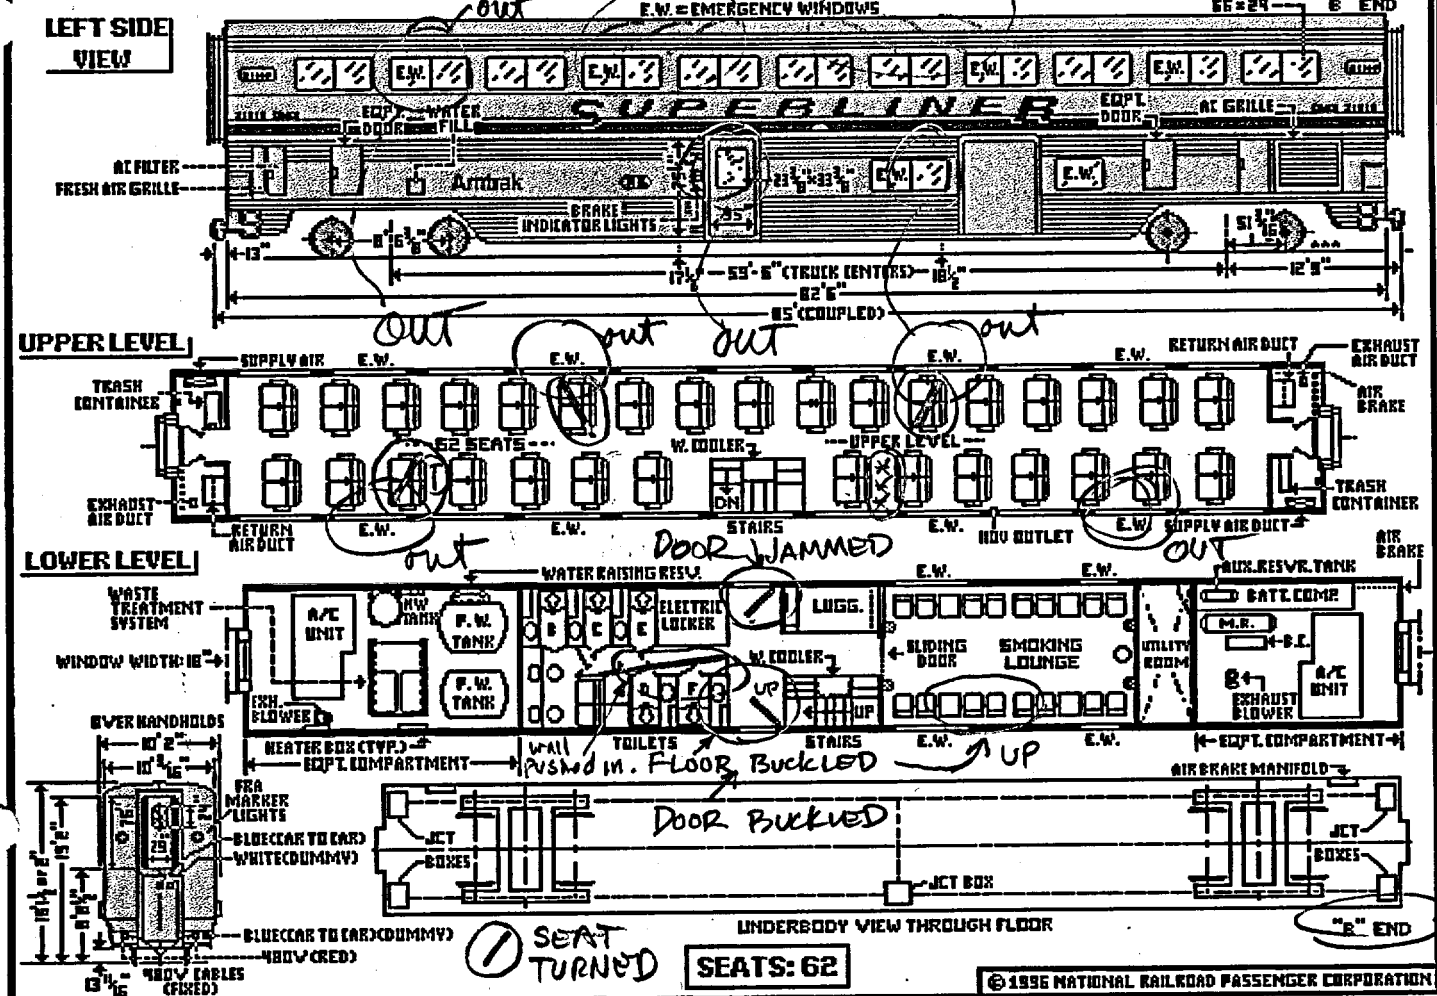

UPPER LEVEL

ITEM	REMARKS	ITEM	REMARKS
Luggage Racks/Dividers	OK	Emergency Tools	
		Maul	✓
		Pry Bar	✓
		First Aid Kit	✓/✓
		Light Sticks	✓/✓
		Fire Extinguisher	✓
		Date:	2/14/01
Emergency Signage	one ceiling sign dented, probably during window removal	Doors	
Interior	OK	End Door "A" End	OK
Exterior	OK	End Door "B" End	OK
End Crash Bars			
A End	OK		
B End	OK		
Other (Specify)			
Med Supplies	Spring cover, oxygen mask, wrappings, Telford mt dressings @ 45/46	Location of Seriously Injured Persons (if known)	Possible @ 45/46

AMTRAK EQUIPMENT INVENTORY - SUPERLINER II LOUNGE

DATE: 3/19 TIME: 2:20 TRAIN NO.: 517 LOCATION: No DAWAY INSPECTOR: PDA
 Car Number / Location in consist: 33034 #10
 Final Orientation / General Exterior Condition: A END DOWN IN DITCH @ 10° Down
 A or B end forward. (Circle one) **A**
 Degree of list, if any, and direction of list: 25 Degrees, (Circle direction) **N**, S, E, W
 Emergency Lights: ON or OFF (Time: 2:20)
 Emergency Windows Open (List by seat location and whether opened from inside (I) or outside (O))
 None
 Seats Unlocked and or Turned (List by seat number)
 N/A
 Damaged and or Missing (Explain) See Diagram
 Emergency Evacuation Cards Total Upper and Lower: Not Applicable

LOWER LEVEL

ITEM	REMARKS	ITEM	REMARKS
Lavatory		Emergency Tools	
		Maul	
		Pry Bar	
Mirrors		First Aid Kit	✓
		Light Sticks	
Tables	OK	Fire Extinguisher	FX CAME LOOSE + DISCHARGED
SEATS	CUSHIONS IN PLACE	Date:	INTO
		Doors	
Emergency Signage		Entry, Eng.'s Side	OK
Interior		Entry, Fire.'s Side	OK
Exterior		Pantry Entry Door	OK
Microwaves	OK IN PLACE	Refrigerator Doors	OK
		Stock	ALL STILL IN PLACE -
Coffee Makers	IN PLACE	Cabinet Doors	OK some spillage but not much.
		Electronic Equipment	
End Crash Bars		Television	IN PLACE - NOT MOVED
A End		Tape Player	NOT SEEN
B End			
Batteries & Box		Location of Seriously Injured Persons (If known)	
Condition of Batteries			
Battery Retention Device			
		Other (Specify)	
Emerg. Evac. Cards	Not Applicable		

SUPERLINER II LOUNGE


WINDOW CRACKS 33034

SUPERLINER II LOUNGE

Equipment Code: SR | 100 MPH | Car Nos: 33025-33049

LEFT SIDE VIEW


END DOOR HEIGHT: 6' 4 1/2"
WIDTH: 31 1/2"

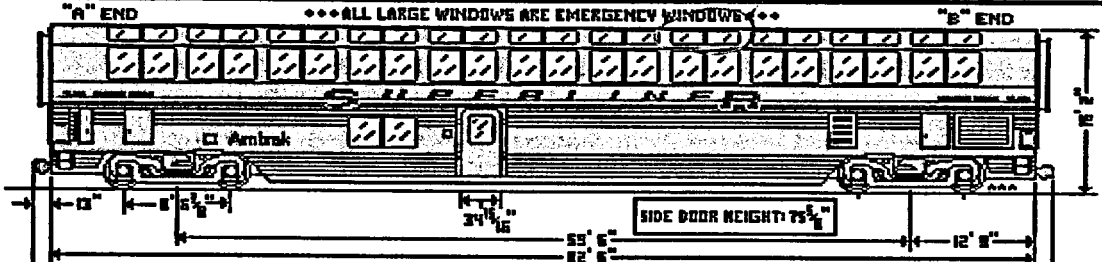

UPPER LEVEL



LOWER LEVEL

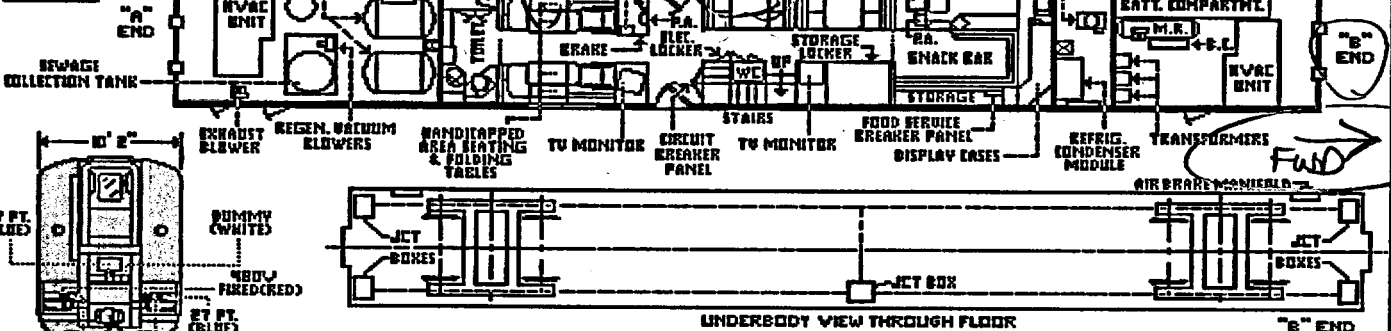

© 1996 NATIONAL RAILROAD PASSENGER CORPORATION

UPPER LEVEL

ITEM	REMARKS	ITEM	REMARKS
Emergency Signage		Emergency Tools	
Interior	ok	Maul	✓
Exterior	ok	Pry Bar	✓
End Crash Bars		First Aid Kit	✓
"A" End	ok	Light Sticks	✓
"B" End	ok	Fire Extinguisher	✓
Other (Specify)		Date:	3/1/01
	All SEATS IN PLACE NO DAMAGE VISIBLE	Doors	
		End Door "A" End	ok shut
		End Door "B" End	ok open
		TV Monitor "A" End	in place
		TV Monitor "B" End	in place
		Location of Seriously Injured Persons (If known)	
		Television Monitors	
		"A" End	
		"B" End	
Emerg. Evac. Cards	Not Applicable		


AMTRAK EQUIPMENT INVENTORY - SUPERLINER I DINER

DATE: 3/19/01 TIME: 3:05p TRAIN NO.: 5(17) LOCATION: NO DAWAY INSPECTOR: PDA
 Car Number / Location in consist: 38033 # 11
 Final Orientation / General Exterior Condition: A END DOWN 3°
 A or B end forward. (Circle one)
 Degree of list, if any, and direction of list: 15° Degrees, (Circle direction) (N) S, E, W
 Emergency Lights: ON or OFF (Time: 3:05p)
 Emergency Windows Open (List by seat location and whether opened from inside (I) or outside (O))
NONE
 Seats Unlocked and or Turned (List by seat number)
N/A
 Damaged and or Missing (Explain)
See Diagram
 Emergency Evacuation Cards Total Upper and Lower: Not Applicable

LOWER LEVEL

ITEM	REMARKS	ITEM	REMARKS
Ovens/Microwaves	<u>In place</u> <u>one door open - At Side</u>	Emergency Tools	<input checked="" type="checkbox"/>
		Maul	<input checked="" type="checkbox"/>
		Pry Bar	<u>NO</u>
		First Aid Kit	<u>NO</u>
Stove	<u>ok In place</u>	Light Sticks	<u>NO</u>
		Fire Extinguisher	<u>NO</u>
		Date:	
Cabinets	<u>closed</u>	Doors	
		Entry, Eng.'s Side	<u>ok</u>
		Entry, Fire.'s Side	<u>ok - entry for Insup.</u>
Emergency Signage		Refrigerator Doors	<u>all ok</u>
Interior	<u>ok</u>		
Exterior	<u>ok</u>	Cabinet Doors	<u>all ok</u>
		Lavatory Door	<u>ok</u>
End Crash Bars		Location of Seriously Injured Persons (if known)	<u>NONE</u>
A End	<u>ok</u>		
B End	<u>ok</u>		
Batteries & Box		Other (Specify)	
Condition of Batteries	<u>unavailable -</u> <u>steep hill</u>	Stock	<u>all loose stock in disarray</u>
Battery Retention Device			

SUPERLINER I DINER

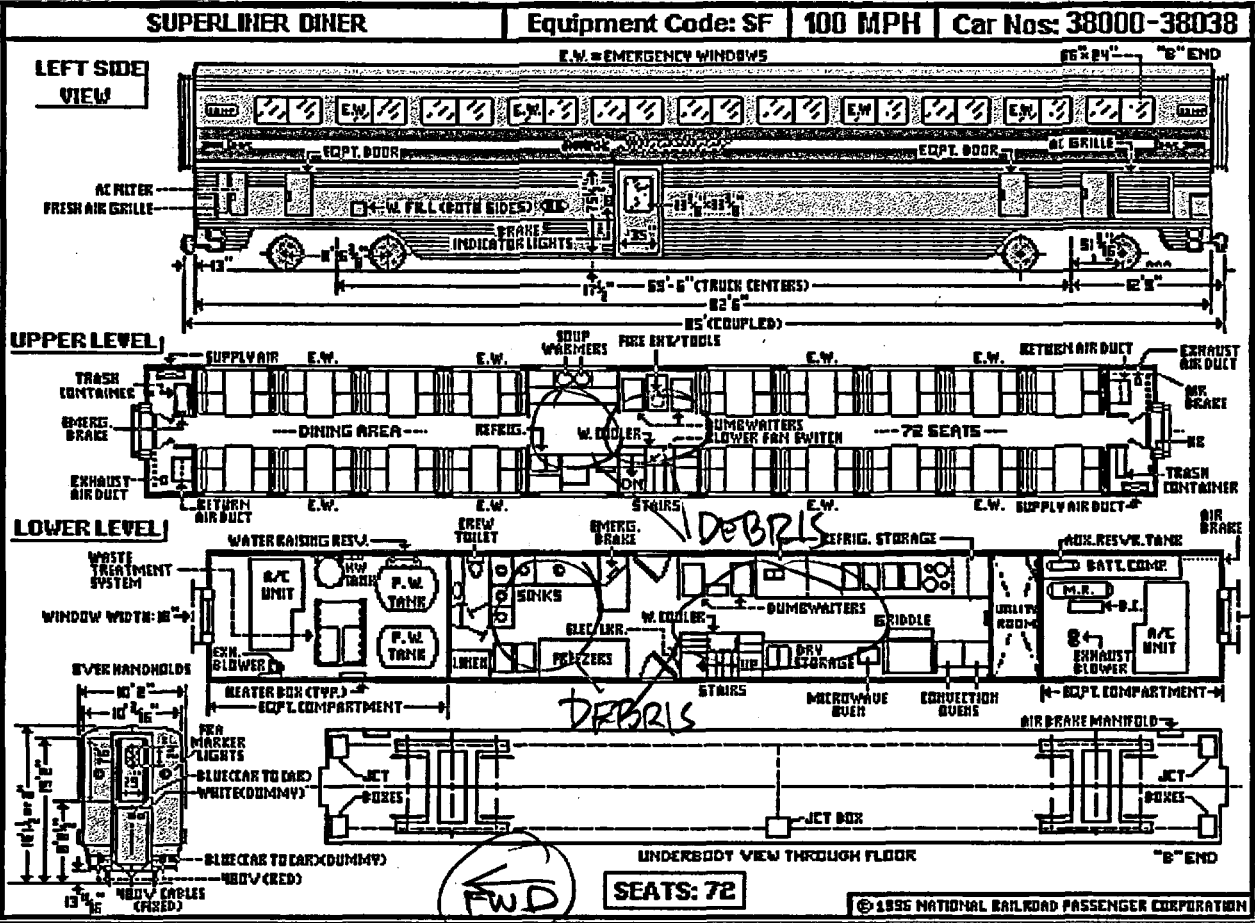

UPPER LEVEL

ITEM	REMARKS	ITEM	REMARKS
Tables	all ok - none moved	Emergency Tools	
SEATS	all ok - none moved	Maul	✓
		Pry Bar	✓
		First Aid Kit	✓
		Light Sticks	✓
		Fire Extinguisher	✓
	Lot of loose + broken Crockery + glasses In pantry	Date:	3/19/01
Emergency Signage		Doors	
Interior	OK	End Door "A" End	OK - Blocked open
Exterior	OK	End Door "B" End	OK open
Coffee Pots	on PA side - Full & hoose	Cabinet Doors	all ok - none open
main	In place	Refrigerator Doors	all ok - new style locked shut w/ padlock
Silverware	In holder + In place	Location of Seriously Injured Persons (If known)	None
		Other (Specify)	

AMTRAK EQUIPMENT INVENTORY

SUPERLINER I SLEEPER

DATE: 3/18/01 TIME: 2:00 TRAIN NO.: 5 LOCATION: NODAWAY INSPECTOR: PDH, JG, JEK

Car Number / Location in consist: 32049 #12

Final Orientation / General Exterior Condition: UPRIGHT

(A) or B end forward. (Circle one)

Degree of list, if any, and direction of list: Degrees, (Circle direction) (N), S, E, W

Emergency Lights: ON or OFF (Time: 2 PM)

Emergency Windows Open (List by seat location and whether opened from inside (I) or outside (O))

NONE

Seats Unlocked and or Tumed (List by seat number)

N/A

Damaged and or Missing (Explain)

Trucks/Lower/undercarriage only

Emergency Evacuation Cards Total Upper and Lower:


all of 42

LOWER LEVEL

ITEM	REMARKS	ITEM	REMARKS
Lavatories	B-LOCKED-LINEN STORAGE	Emergency Tools	
	ALL OK	Maul	✓
		Pry Bar	✓/✓/✓
		First Aid Kit	✓/✓/✓
		Light Sticks	✓ IN USE
Mirrors/Beds/Walls		Fire Extinguisher	✓
Room # H	OK	Date:	3/1/01
Room # 11	OK	Doors	
Room # 12	DEAL MISSING, ELSE OK	Entry, Eng.'s Side	OK
Room # 13	DEAL MISSING, ELSE OK	Entry, Fire.'s Side	OK
Room # 14	OK		
Room # 15	2 DEALS MISSING, ELSE OK	Emergency Signage	
Luggage Racks/Dividers	OK	Interior	OK
		Exterior	
End Crash Bars		Location of Seriously Injured Persons (If known)	NONE
A End			
B End			
Batteries & Box		Other (Specify)	
Condition of Batteries		FRESH WATER	LEAK AT CAR MIDPT, LEFT SIDE
Battery Retention Device		Step Box	OK
		ADA ramp	OK
Emerg. Evac. Cards	of 12	ADA retention strap	OK

SUPELINER I SLEEPER - ALL STYLES

32049

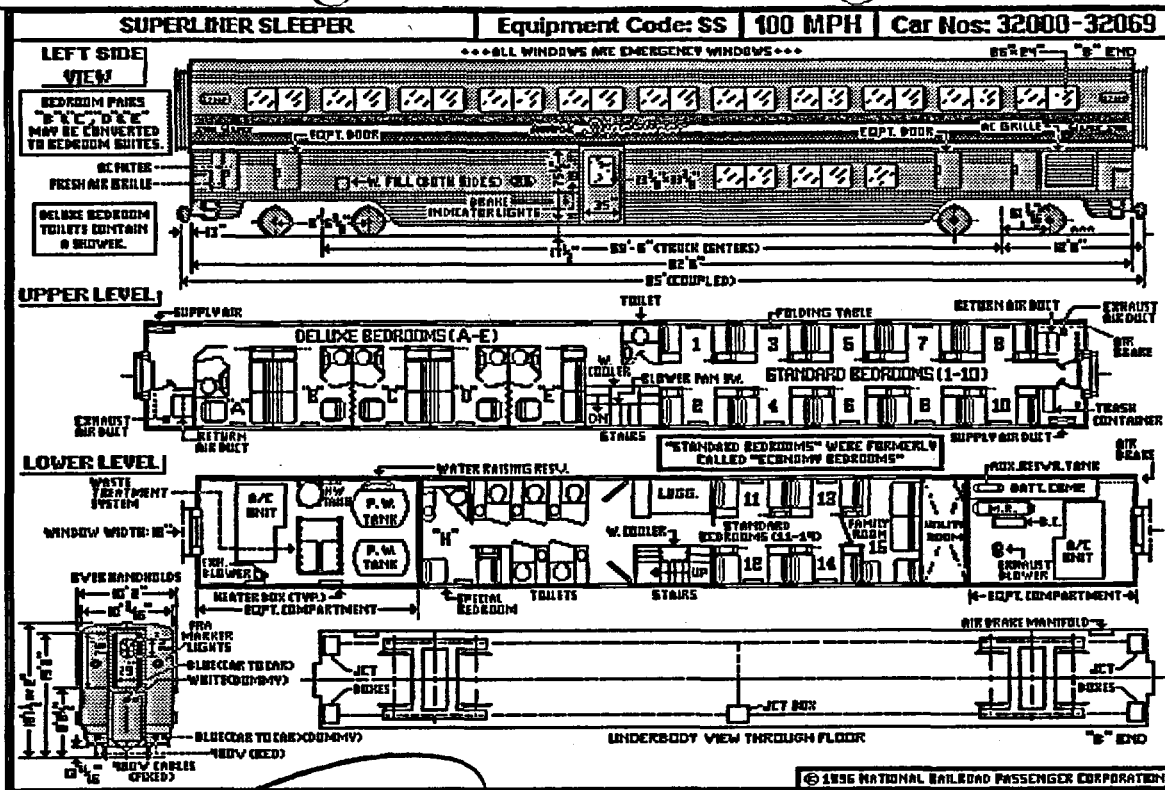

Direction of Travel →

UPPER LEVEL

ITEM	REMARKS	ITEM	REMARKS
Lavatories	All OK	Emergency Tools	
		Maul	✓
		Pry Bar	✓
Mirrors/Beds/Walls	All OK	First Aid Kit	✓
Room # A		Light Sticks	✓
Room # B	OK	Fire Extinguisher	✓
Room # C	OK	Date:	3/1/01
Room # D	OK	Doors	
Room # E WINDOW	DECAL MISSING	Including Bedroom	
Room # 1	OK	Specify	
Room # 2	OK	End Door "A" End	Closed
Room # 3	OK	End Door "B" End	Open
Room # 4	OK	Location of	
Room # 5	OK	Seriously	
Room # 6	OK	Injured Persons	NONE
Room # 7	OK	(If known)	
Room # 8 WINDOW	DECAL MISSING	End Crash Bars	
Room # 9	OK	A End	Some Diaphragm Damage
Room # 10	OK	B End	OK LT SIDE SOME DIAPHRAGM DAMAGE
Emergency Signage		Other (Specify)	
Interior	OK	COFFEE POT	LOCKED DOWN
Exterior	OK		
Emerg. Evac. Cards	All of 30		

AMTRAK EQUIPMENT INVENTORY

SUPERLINER II SLEEPER

DATE: 3/18/2001 TIME: 11:30 TRAIN NO. 5(17) LOCATION: NoDAWAY Inspector: PDH, JJB, JEK

Car Number / Location in consist: 32096 #13
 Final Orientation / General Exterior Condition: UPRIGHT - LOAD TRUCK DERAILED
 A or B end forward. (Circle one)
 Degree of list, if any, and direction of list: 2° (Circle direction) (N, S, E, W)
 Emergency Lights: ON or OFF (OFF) Time: 11:30 PM
 Emergency Windows Open (List by seat location and whether opened from inside (I) or outside (O))

NONE

Seats Unlocked and or Turned (List by seat number)

Damaged and or Missing (Explain) N/A

NONE

Emergency Evacuation Cards Total Upper and Lower: IN PLACE


LOWER LEVEL

ITEM	REMARKS	ITEM	REMARKS
Lavatories		Emergency Tools	
Shower	TRASH BIN FELL OFF WALL	Maul	✓
LAUS	ALL OK	Pry Bar	✓
		First Aid Kit	✓
		Light Sticks	USED - MANY
Mirrors/Beds/Walls		Fire Extinguisher	✓
Room # H	ALL OK	Date:	3/7/01
Room # 11	INT WINDOW DETAIL MISSING	Doors	
	ELSE ALL OK	Entry, Eng.'s Side	OK
Room # 12	ALL OK		
Room # 13	ALL OK	Entry, Fire.'s Side	OK
Room # 14	ALL OK		
Room # 15	ALL OK	Emergency Signage	
Luggage Racks/ Dividers	ALL OK	Interior	OK
		Exterior	OK
RAMP	OK IN PLACE		
End Crash Bars		Location of Seriously Injured Persons (If known)	NONE
A End	OK		
B End	OK		
Batteries & Box		Other (Specify)	
Condition of Batteries		Step Box	IN USE
Battery Retention Device		ADA ramp	OK
		ADA retention strap	OK
Emerg. Evac. Cards	of 12		

32096

SUPERLINER II SLEEPER - ALL STYLES

SUPERLINER II SLEEPER Equipment Code: SS | 100 MPH | Car Nos: 32070-32118

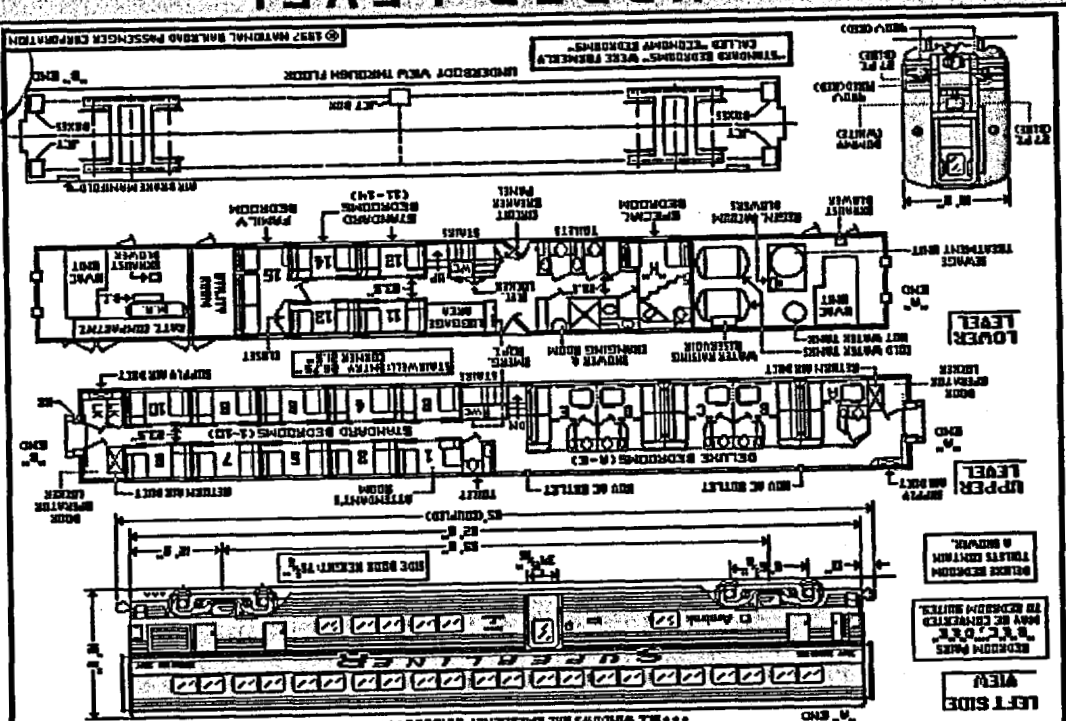

UPPER LEVEL

ITEM	REMARKS	ITEM	REMARKS
ITEM	REMARKS	ITEM	REMARKS
Emergency Tools	510 PM LAB DV	Emergency Tools	
Mantle		Mantle	
Pry Bar		Pry Bar	
First Aid Kit		First Aid Kit	✓ SERVED
Light Sticks		Light Sticks	✓ SERVED
Fire Extinguisher		Fire Extinguisher	3/7/01
Date:		Date:	
Doors		Doors	
Including Bedroom		Including Bedroom	
Specify		Specify	
End Door "A" End		End Door "A" End	
End Door "B" End		End Door "B" End	
Room # 1	All OK	Room # 1	All OK
Room # 2	All OK	Room # 2	All OK
Room # 3	All OK	Room # 3	All OK
Room # 4	All OK	Room # 4	All OK
Room # 5	All OK	Room # 5	All OK
Room # 6	All OK	Room # 6	All OK
Room # 7	All OK	Room # 7	All OK
Room # 8	All OK	Room # 8	All OK
Room # 9	All OK	Room # 9	All OK
Room # 10	All OK	Room # 10	All OK
End Crash Bars		End Crash Bars	
A End	OK - Some PROPHASE DAMAGE	A End	OK - Some PROPHASE DAMAGE
B End	OK	B End	OK
Emerg. Evac. Cards		Emerg. Evac. Cards	

REMARKS

ITEM

REMARKS

ITEM

FWD